



- / High accuracy readings
- / Wide backlight display
- Configurable analog outputs
- Settings via USB or keypad
- Alarm output and built-in buzzer


The RHT Climate transmitter incorporates high accuracy and stability sensors for relative humidity and temperature measurement and can transmit both signals through two analog outputs or RS485 Modbus RTU communication. The device allows complete parameters configuration through the USB interface, simulation of temperature and humidity, forcing the retransmission signals or even diagnostics through NXperience software. RHT Climate has models with or without display for wall or duct mount, with various probe lengths.


Typical Applications

RHT Climate is suitable for general use in HVAC-R applications, that is, monitoring or climate control of environments or even environmental monitoring of industrial processes where robustness, accuracy and connectivity are required.

Accuracy of Measures and Operational Limits of Sensors


Relative Humidity Accuracy

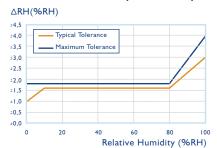

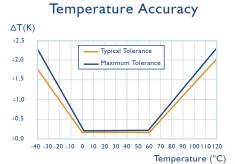

Sp

Sensor Operation Conditions

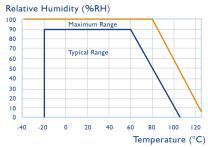

The RHT Climate can be configured to display and retransmit the temper or any of its psychrometric properties, calculated in real time:

- Dew Point Temperature
- Wet Bulb Temperature
- Absolute Humidity
- Frost Point Temperature







Technical specifications

Sensor Measurement Range:	Temperature:	-40,0 °C to 100,0 °C (DM models) -40,0 °C to 60,0 °C (WM models)				
	Relative Humidity:	0.0 to 100.0% RH (non-condensing)				
	Dew Point:	-90,0 °C to 100,0 °C				
Measurement Resolution:	Temperature:	0,1 °C, 14 bits (65535 levels)				
	Relative Humidity:	0,1%, 12 bits (4095 levels)				
Response Time:	Temperature:	up to 5 s @ 25 °C with slow moving air (1 m/s)				
	Relative Humidity:	up to 4 s @ 25 °C with slow moving air (1 m/s)				
Measurement Accuracy:	Temperature:	±0,2 °C (0 °C to +60 °C)				
	Relative Humidity:	±1,8% RH @ +23 °C (0% RH to 90% RH)				
Sampling Interval:	3 seconds					
Custom Calibration:	Up to five temperature points and five points for relative humidity					
Analog Outputs:	Two 0-10 V or 4-20 mA outputs configurable by software or keyboard					
Power Supply:	By Connectors:	12 Vdc to 30 Vdc; maximum consumption 70 mA +/- 10% @ 24 Vdc				
	By USB:	4.75 Vdc to 5.25 Vdc				
Display:	Wide backlight LCD with three variables of 4 1/2 digits					
Keys:	3 keys with tactile feedback for navigation and adjustment of parameters					
Alarms:	Two digital outputs and one embedded buzzer					
Operating Temperature:	-40 °C to 60 °C					
Connections:	Internal terminals through cable glands					
Dimensions:	100.3 x 80.0 x 45.1 mm					
Enclosure:	ABS+PC					
Protection Rating:	Enclosure:	IP65				
	Sensor probe:	IP30, depending on the filter cap				
Communication Interface:	USB type Micro-B 2.0 and RS485 (both in Modbus RTU)					
Programming:	NXperience software for Windows through USB					

Models

Part Number	USB	Two Analog Out	Alarm Digital Out	Stainless Steel Probe (mm)	LCD	RS485
880400000	\checkmark	\checkmark	\checkmark			
8804000101	\checkmark	\checkmark	\checkmark		\checkmark	\checkmark
8804111000	\checkmark	\checkmark	\checkmark	150 mm		
8804111001	\checkmark	\checkmark	\checkmark	150 mm		\checkmark
8804111101	\checkmark	\checkmark	\checkmark	150 mm	\checkmark	\checkmark
8804121000	\checkmark	\checkmark	\checkmark	250 mm		
8804121001	\checkmark	\checkmark	\checkmark	250 mm		\checkmark
8804121101	\checkmark	\checkmark	\checkmark	250 mm	\checkmark	\checkmark
8804131000	\checkmark	\checkmark	\checkmark	400 mm		
8804131001	\checkmark	\checkmark	\checkmark	400 mm		\checkmark
8804131101	\checkmark	\checkmark	\checkmark	400 mm	\checkmark	\checkmark

