



C€







Model Number

OBR12M-R100-2EP-IO-0,3M-V31-L

Laser retroreflective sensor with fixed cable and 4-pin, M8 connector

Features

- Miniature design with versatile mounting options
- DuraBeam Laser Sensors durable and employable like an LED
- Extended temperature range -40°C ... 60°C
- High degree of protection IP69K
- IO-link interface for service and process data

Product information


The R100 series miniature optical sensors are the first devices of their kind to offer an end-to-end solution in a small single standard design — from thru-beam sensor through to a distance measurement device. As a result of this design, the sensors are able to perform practically all standard automation tasks.

The entire series enables sensors to communicate via IO-Link.


The DuraBeam laser sensors are durable and can be used in the same way as a standard sensor.

The use of Multi Pixel Technology gives the standard sensors a high level of flexibility and enables them to adapt more effectively to their operating environment.

Dimensions

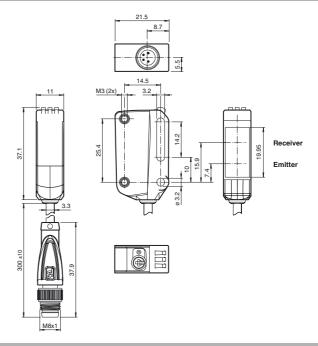

Electrical connection




Pinout

Wire colors in accordance with EN 60947-5-2

² 1 3 4 3

1 BN (brown)
2 WH (white)
3 BU (blue)
4 BK (black)

Indicators/operating means

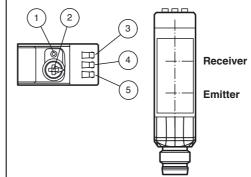

- 1 Light-on/Dark-on changeover switch
- 2 Sensitivity adjuster
- 3 Operating indicator / dark on
- 4 Signal indicator
- 5 Operating indicator / light on

www.pepperl-fuchs.com

Technical data General specifications Effective detection range 0 ... 12 m 0.2 ... 12 m Reflector distance Threshold detection range 15 m H50 reflector Reference target Light source laser diode Light type modulated visible red light Polarization filter Laser nominal ratings LASER LIGHT, DO NOT STARE INTO BEAM Laser class Wave length Beam divergence > 5 mrad d63 < 2 mm in the range of 250 mm ... 750 mm Pulse length 1.6 µs Repetition rate max 17 6 kHz max. pulse energy 9.6 nJ Diameter of the light spot approx. 30 mm at a distance of 12 m Angle of divergence approx. 0.3

Ambient light limit Functional safety related parameters

672 a $MTTF_d$ Mission Time (T_M) 20 a Diagnostic Coverage (DC) 0 %

Indicators/operating means

Operation indicator LED green:

constantly on - power on flashing (4Hz) - short circuit

flashing with short break (1 Hz) - IO-Link mode

Function indicator Yellow LED

Permanently lit - light path clear Permanently off - object detected

Flashing (4 Hz) - insufficient operating reserve

Control elements Light-on/dark-on changeover switch

sensitivity adjustment Control elements

Parameterization indicator IO link communication: green LED goes out briefly (1 Hz)

EN 60947-5-2

Electrical specifications

Operating voltage U_{B} 10 ... 30 V DC Ripple max 10 %

No-load supply current I₀ < 20 mA at 24 V supply voltage

Protection class

Interface

Interface type IO-Link (via C/Q = pin 4) Transfer rate COM 2 (38.4 kBaud) 1.1

IO-Link Revision 2.3 ms Min. cycle time

Process data witdh Process data input 2 Bit Process data output 2 Bit

SIO mode support 0x110202 (1114626) Device ID

Compatible master port type

Output

Switching type The switching type of the sensor is adjustable. The default

setting is:

C/Q - Pin4: NPN normally open / dark-on, PNP normally closed /

light-on, IO-Link

/Q - Pin2: NPN normally closed / light-on, PNP normally open /

2 push-pull (4 in 1)outputs, short-circuit protected, reverse Signal output

polarity protected, overvoltage protected

max. 30 V DC

max. 100 mA, resistive load Switching current DC-12 and DC-13 Usage category

≤ 1.5 V DC Voltage drop 2000 Hz

Switching frequency Response time 250 us

Conformity

IEC 61131-9 Communication interface FN 60947-5-2 Product standard Laser safety EN 60825-1:2014

Ambient conditions

Switching voltage

Ambient temperature

-40 ... 60 °C (-40 ... 140 °F) , fixed cable -25 ... 60 °C (-13 ... 140 °F) , movable cable not appropriate for

conveyor chains

-40 ... 70 °C (-40 ... 158 °F) Storage temperature

Mechanical specifications

Housing width 11 mm Laserlabel



CLASS 1 LASER PRODUCT

IEC 60825-1: 2007 certified. Complies with 21 CFR 1040.10 and 1040.11 except for deviations pursuant to Laser Notice No. 50. dated June 24, 2007

CLASS 1 LASER PRODUCT

IEC 60825-1: 2007 certified. Complies with 21 CFR 1040.10 and 1040.11 except for deviations pursuant to Laser Notice No. 50, dated June 24, 2007

Accessories

IO-Link-Master02-USB

IO-Link master, supply via USB port or separate power supply, LED indicators, M12 plug for sensor connection

OMH-R10X-01

Mounting bracket

OMH-R10X-02

Mounting bracket

OMH-R10X-04

Mounting bracket

OMH-R10X-10

Mounting bracket

OMH-ML100-03

Mounting aid for round steel ø 12 mm or sheet 1.5 mm ... 3 mm

OMH-ML100-031

Mounting aid for round steel ø 10 ... 14 mm or sheet 1 mm ... 5 mm

RFF-MH82

Reflector with Micro-structure, rectangular 82 mm x 60 mm, mounting holes

REF-MH20

Reflector with Micro-structure, rectangular 32 mm x 20 mm, mounting holes

REF-MVR10

Reflector with Micro-structure, rectangular 60 mm x 19 mm, mounting holes

V31-GM-2M-PUR


Female cordset, M8, 4-pin, PUR cable


V31-WM-2M-PUR

Female cordset, M8, 4-pin, PUR cable


Housing height	37.1 mm
Housing depth	21.5 mm
Degree of protection	IP67 / IP69 / IP69K
Connection	fixed cable 300 mm with M8 x 1 male connector; 4-pin
Material	
Housing	PC (Polycarbonate)
Optical face	PMMA
Mass	approx. 15 g
Cable length	0.3 m
Approvals and certificates	
UL approval	E87056, cULus Listed, class 2 power supply, type rating 1
FDA approval	IEC 60825-1:2007 Complies with 21 CFR 1040.10 and 1040.11 except for deviations pursuant to Laser Notice No. 50, dated June 24, 2007

Curves/Diagrams

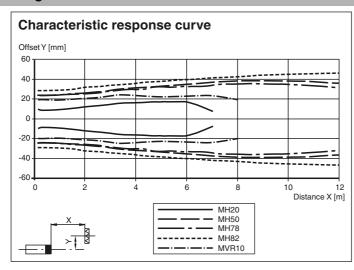

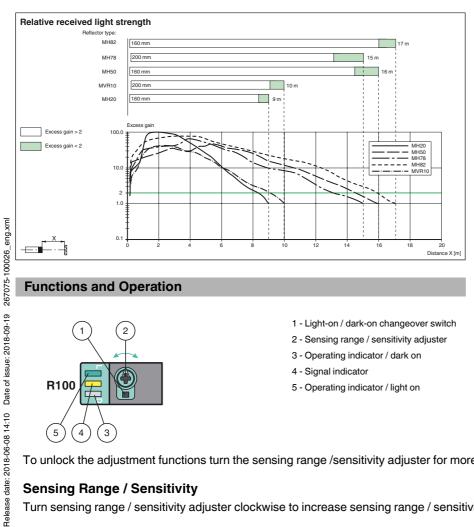

Functions and Operation

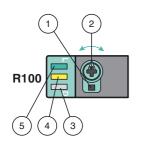

- 1 Light-on / dark-on changeover switch
- 2 Sensing range / sensitivity adjuster
- 3 Operating indicator / dark on
- 4 Signal indicator
- 5 Operating indicator / light on

To unlock the adjustment functions turn the sensing range /sensitivity adjuster for more than 180 degrees.

Sensing Range / Sensitivity

Turn sensing range / sensitivity adjuster clockwise to increase sensing range / sensitivity.

Turn sensing range / sensitivity adjuster counter clockwise to decrease sensing range / sensitivity.

If the end of the adjustment range is reached, the signal indicator starts flashing with 8 Hz.

Light-on / Dark-on Configuration

Press the light-on / dark-on changeover switch for more than 1 second (less than 4 seconds). The light-on / dark-on mode changes and the operating indicators are activated accordingly.

If you press the light-on / dark-on changeover switch for more than 4 seconds, the light-on /dark-on mode changes back to the original setting. On release of the light-on / dark-on changeover switch the current state is activated.

Restore Factory Settings

Press the light-on / dark-on changeover switch for more than 10 seconds (less than 30 seconds) until all LEDs turn off. On release of the light-on / dark-on changeover switch the signal indicator turns on. After 5 seconds the sensor resumes operation with factory default settings.

After 5 minutes of inactivity the sensing range / sensitivity adjustment is locked. In order to reactivate the sensing range / sensitivity adjustment, turn the sensing range /sensitivity adjuster for more than 180 degrees.

PEPPERL+FUCHS